

GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 8

TACAN GSB Chan 112	APCH CRS 081°	Rwy Idg 11,760 TDZE 73 Arpt Elev 109
------------------------------	-------------------------	---

[USAF]

SEYMOUR JOHNSON AFB (KGSB)


T * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1 3/8 miles.
** Circling N of Rwy 8-26 not authorized.

ALSF-1



MISSED APPROACH: Climb to 2300 via GSB R-081 to ZLOB and hold.

ATIS ★ 317.625	APP CON 123.7 290.9 (258°- 110°) 119.7 273.6 (111°- 257°)	TOWER ★ 126.25 370.875	GND CON 132.45 275.8	CLNC DEL 128.025 270.8
-------------------	---	---------------------------	-------------------------	---------------------------

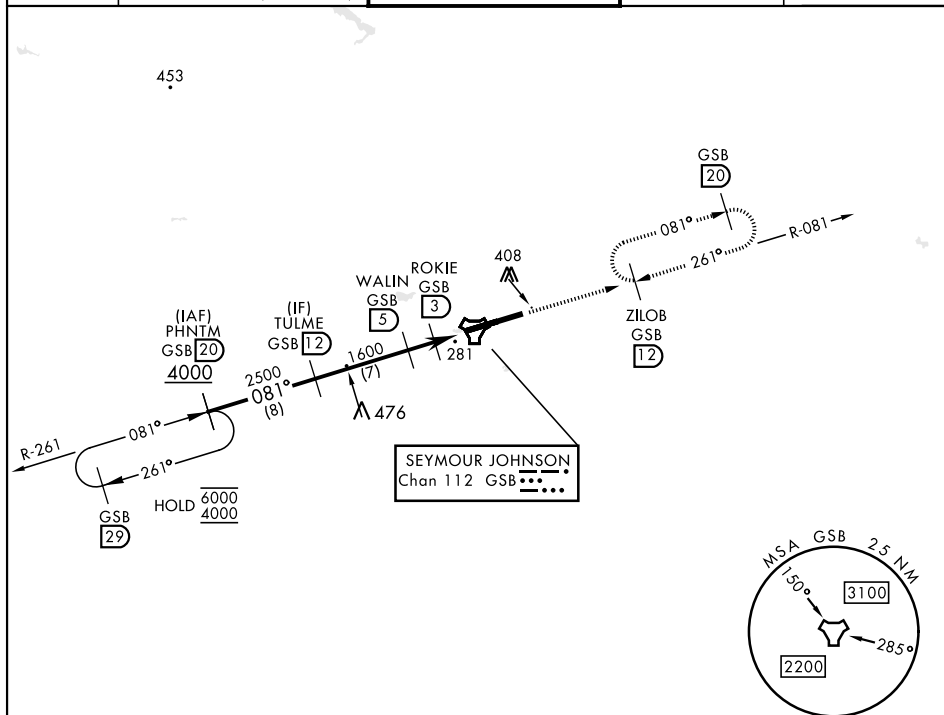

EMERG SAFE ALT 100 NM 3700

ELEV	109		TDZE	73
------	-----	--	------	----

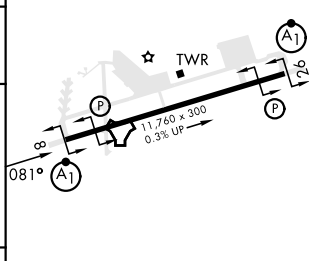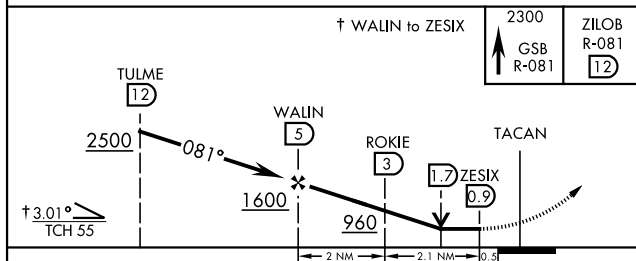

CATEGORY	A	B	C	D	E
S-8 *	540/24 467 {500-½}		540/50 467 {500-1}		
 CIRCLING **	580-1 471 {500-1}	600-1 491 {500-1}	680-1½ 571 {600-1½}	740-2 631 {700-2}	740-2½ 631 {700-2½}

HIRL Rwy 8-26

GOLDSBORO, NORTH CAROLINA

35°20'N-77°58'W

SFYMOUR JOHNSON AFB (KGSB)

Amdt 8 03NOV22

TACAN Y RWY 8

SE-2, 22 FEB 2024 to 21 MAR 2024