

ILS RWY 3 (SA CAT I)
GREAT FALLS INTL (GTF)

MISSED APPROACH: Climb to 5000 then climbing right turn to 8300 direct GTF VORTAC then on GTF VORTAC R-209 to FRYMN/I-SMR 16.9 DME and hold.

MSA GTF 25 NM

6100

8600

070°

230°

GREAT FALLS

115.1 GTF

Chan 98

8300 to FRYMN

209° (13.4)

DCEEE

I-SMR 9

GTF

R-209

6000

032°

(IF/IAF)

FRYMN

I-SMR 16.9

212°

1 min

032°

6142

6139

8300 NoPT to FRYMN

322° (8.5) and 032° (4.5)

(IAF)

HOXEK

GTF 22.3

6629

6257

4032

IM

3829

4117

LOCALIZER 111.3

I-SMR

Chan 50

DME REQUIRED


ELEV 3680

TDZE 3680

41

DME REQUIRED


ELEV 3680	D	TDZE 3680
-----------	----------	-----------

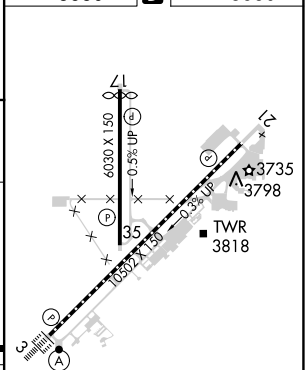

TDZ/CL Rwy 3
REIL Rwy 21
HIRL Rwy 3-21
MIRL Rwy 17-35

5000 ↑	8300 ↗	GTF 	GTF R-209	FRYMN I-SMR 16.9
-----------	-----------	--	--------------	------------------------

Use I-SMR DME when on the localizer course.

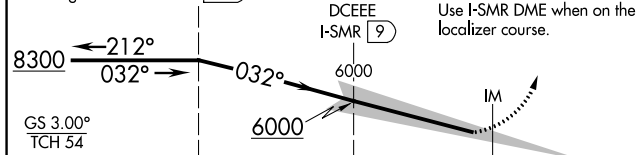

		7.9 NM	7.1 NM	1099'
CATEGORY	A	B	C	D
S-ILS 3	RA 140/14 150 DA 3830			

SA CATEGORY I ILS-SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED