

LOC/DME I-HRJ 108.35 Chan 20 (Y)	APP CRS 048°	Rwy Idg 5005 TDZE 196 Apt Elev 202
--	------------------------	---

LOC RWY 5
HARNETT RGNL JETPORT (HRJ)


DME required.

MISSED APPROACH: Climb to 700 then climbing left turn to 2000 on heading 290° and RDU R-194 to LANHO INT/RDU 21.2 DME and hold.




AWOS-3
119.025


FAYETTEVILLE APP CON
125,175 285,575

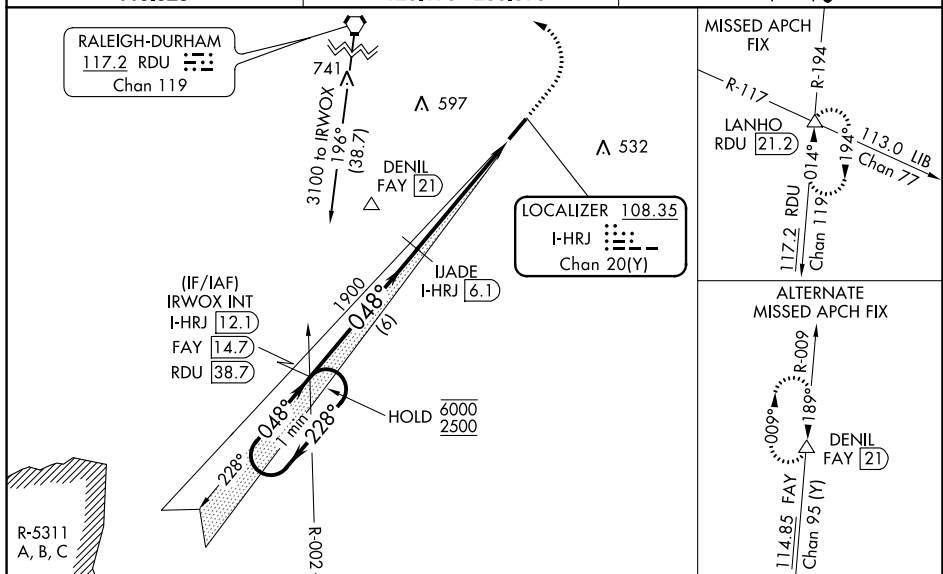UNICOM
122.7 (CTAF) **L**R-5311
A. B. C


SE-2, 22 FEB 2024 to 21 MAR 2024

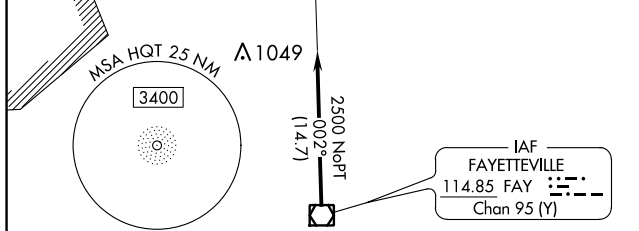

VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 39).

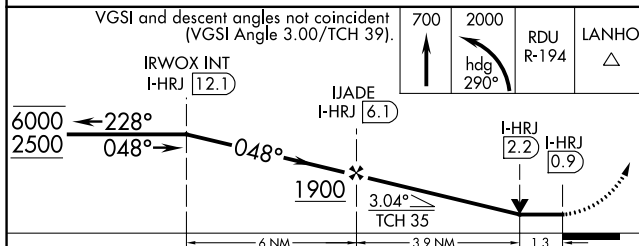

CATEGORY	A	B	C	D
S-5	640-1	444 (500-1)	640-1 $\frac{3}{8}$ 444 (500-1 $\frac{3}{8}$)	NA
 CIRCLING	660-1 458 (500-1)	720-1 518 (600-1)	780-1 $\frac{1}{2}$ 578 (600-1 $\frac{1}{2}$)	NA

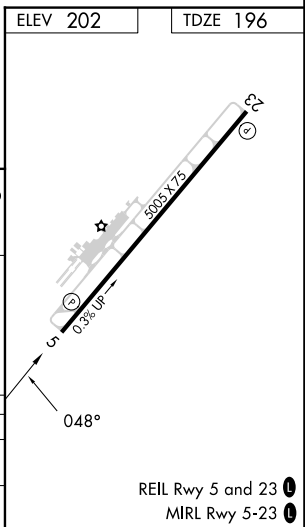

ERWIN, NORTH CAROLINA
Orig-C 08SEP22

35°23'N-78°44'W

HARNETT RGNL JETPORT (HRJ)
LOC RWY 5

REIL Rwy 5 and 23 **L**
MIRL Rwy 5-23 **L**