

APP CRS
259°

Rwy ldg
TDZE
Apt Elev

9800
38
38

RNAV (GPS) RWY 26

HILO INTL (ITO) (PHTO)

RNP APCH.

⚠

⚠

Circling NA south of Rwy 8-26. Rwy 26 helicopter visibility reduction below ¾ SM NA. WAAS VNAV NA. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to ¾ SM and increase LNAV Cat A/B visibility to 1 SM.


MALSR

⚠


⚠

MISSED APPROACH: Climb to 500 then climbing right turn to 4000 direct CABIX and hold, continue climb-in-hold to 4000.

ATIS 126.4	HILO APP CON* 119.7 269.2	HILO TOWER* 118.1(CTAF) 0 263.1	GND CON 121.9
---------------	------------------------------	------------------------------------	------------------

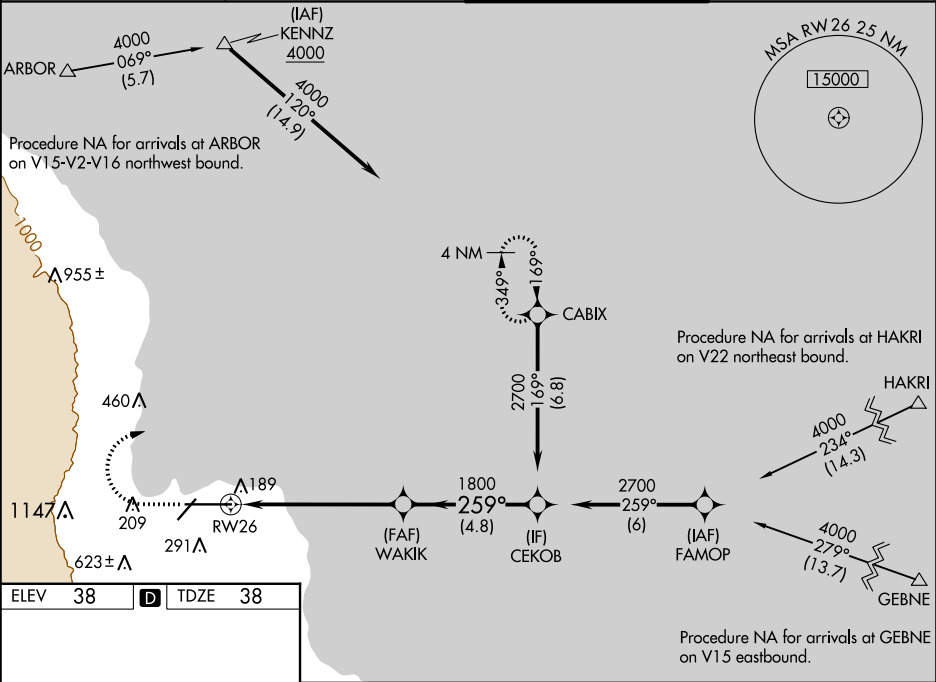

ELEV 38	D	TDZE 38
---------	---	---------

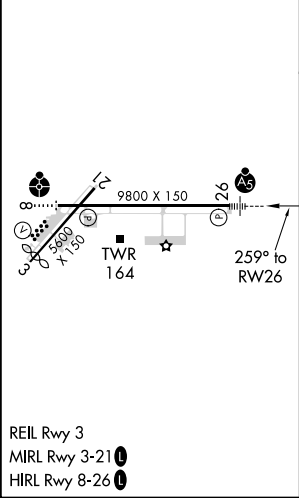

REIL Rwy 3
MIRL Rwy 3-21
HIRL Rwy 8-26

500 4000 CABIX VGSIs and RNAV glidepath not coincident (VGSi Angle 2.60/TCH 70).				
*LNAV only				
*1.3 NM to RWY 26				
1.3 4.9 NM 4.8 NM				
CATEGORY	A	B	C	D
LNAV/VNAV DA	350-3/4 312 (400-3/4)			
LNAV MDA	460-3/4 422 (500-3/4)			
CIRCLING	500-1 462 (500-1)	540-1 502 (600-1)	840-2 1/4 802 (900-2 1/4)	1320-3 1282 (1300-3)